

# Manhole Inspection Summary

Manhole # S05UU1024MH

Printed On: 12/17/2008

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **05UU1** Node: **024** Status: **Found**

Insp Date: **9/26/06 12:00 AM**

Incomplete Comments

Crew: **WM, HDP, JY**  
Inspector: **Yi, J**  
Firm: **RKK**

**Location** Address: **3500 W NORTHERN PKWY**

Cross Street: **CLOVER RD**

**Manhole** Type: **Junction**

Location: **Grass**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **This MH is located in the school yard. The I9 pipe picture shows grease deposits in the Channel.**

**Cover**

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **2** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **42** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

**Bench**

☒ Exists Material: **Brick**

☐ Parged

☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Steps**

Count: **3**

Missing: **0**

☒ **Corroded**

**Surcharge**

☒ **Evidence Of Surcharge**

Depth: **3**

(ft.)

☐ Active Surcharge Present

Location View



Top View



Corroded steps. Evidence of surcharge - Bench debris. Channel debris.

Defect



Frame leaks. Adjustment deterioration and infiltration. Corbel and Barrel infiltration - other side.

Defect



Frame leaks. Adjustment deterioration and infiltration. Corbel and Barrel infiltration.

# Manhole Inspection Summary

Manhole # S05UU1024MH

Printed On: 12/17/2008

Page 3 of 4

## 8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Barrel deterioration and infiltration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.59** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ Grease

Silt Depth: **0** (in.) Deposits Extent: **Light**


Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

## 8 in. Circular Gravity Sewer Pipe In @ 3 O'Clock

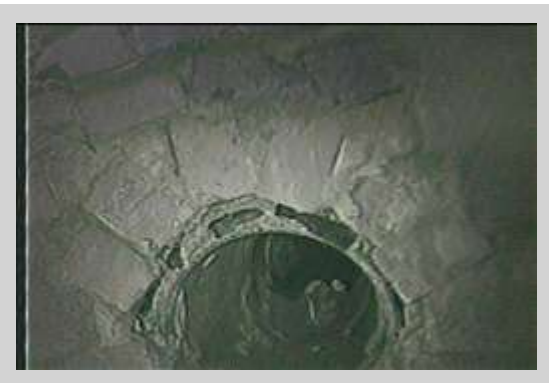

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **4.52** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Broken**

## Drop In @ 3 O'Clock



Drop: **Outside** Rod and Bar  
Angled: **Yes** Reading: **5.35** (ft.)  
Inv Depth: **6.35** (ft.)

Drop Condition: **Partly Clogged**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S05UU1024MH

Printed On: 12/17/2008

Page 4 of 4

8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Channel grease.

Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **6.35** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.)

Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection